
MS8607-02BA01 PTH Fusion Sensor



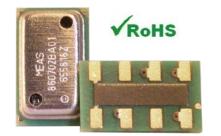

- Integrated pressure, temperature and humidity sensor
- QFN package 5 x 3 x 1 mm³
- Operating range: 10 to 2000 mbar, 0%RH to 100%RH, -40 to 85 °C
- High-resolution module: 0.016 mbar, 0.04%RH, 0.01°C
- Supply voltage: 1.5 to 3.6 V
- Fully factory calibrated sensor
- I²C interface

DESCRIPTION

The MS8607 is the novel digital fusion sensor of MEAS providing 3 environmental physical measurements all-inone: pressure, temperature and humidity (PTH). This product is optimal for applications in which key requirements such as ultra low power consumption, high PTH accuracy and compactness are critical. High pressure resolution combined with high PTH linearity makes the MS8607 an ideal candidate for environmental monitoring and altimeter in smart phones and tablet PC, as well as PTH applications such as HVAC and weather stations. This new sensor module generation is based on leading MEMS technologies and latest benefits from Measurement Specialties proven experience and know-how in high volume manufacturing of sensor modules, which has been widely used for over a decade.

FEATURES

TECHNICAL DATA

Sensor Performances (VDD	= 3 V)								
Characteristics	Pressure [mbar]			Relative Humidity [%RH]			Temperature [°C]		
	Min	Тур	Max	Min	Тур	Max	Min	Тур	Max
Max. Operating Range	10		2000	0		100	-40		+85
	3001200mbar			2080%RH			@ 25°C		
Absolute Accuracy @25°C	-2		2	-3		3	-1		1
Resolution (highest mode)		0.016			0.04			0.01	

FIELD OF APPLICATION

- Smart phones and Tablet PCs
- HVAC applications
- Weather station
- Printers
- Home Appliance and humidifiers

Sold in North America by: Servoflo Corporation 75 Allen Street Lexington, MA 02421 Tel: 781-862-9572

www.servoflo.com / info@servoflo.com



PERFORMANCE SPECIFICATIONS

ABSOLUTE MAXIMUM RATINGS

Parameter	Symbol	Condition	Min.	Тур.	Max.	Unit
Supply voltage	V _{DD}		-0.3		3.6	V
Storage temperature	Ts		-20		85	°C
Overpressure	P _{max}			6		bar
Maximum Soldering Temperature	T _{max}	40 sec max			250	°C
ESD rating		Human Body Model	-2		2	kV
Latch up		JEDEC standard No 78	-100		100	mA

ELECTRICAL CHARACTERISTICS

Parameter		General	electrical cl	naracteristics		
	Symbol	Condition	Min.	Тур.	Max.	Unit
Operating Supply voltage	V _{DD}		1.5	3.0	3.6	V
Operating Temperature	Т		-40	+25	+85	°C
VDD to GND Capacitor			220	470		nF
Supply current P or T (1 Pressure or temperature conversion per sec.)	Ірт	OSR 8192 4096 2048 1024 512 256		20.09 10.05 5.02 2.51 1.26 0.63		μΑ
Supply current H (1 humidity conversion per sec.)	I _H	OSR 8192 4096 2048 1024		6.22 3.11 1.56 0.78		μΑ
Peak supply current (during P or T conversion)				1.25		mA
Peak supply current (during humidity conversion)				0.45		mA
Standby supply current		@ 25°C, V _{DD} = 3V		0.03	0.24	μA

	Press	ure and	temperatu	ire		Relative hu	midity	
	Condition	Min.	Тур.	Max.	Min.	Тур.	Max.	Unit
ADC Output Word			24			16		bit
	OSR 8192		16.44	17.2		13.82	15.89	
ADC Conversion time ⁽³⁾	4096		8.22	8.61		6.98	8.03	
	2048		4.13	4.32		3.55	4.08	
	1024		2.08	2.17		1.84	2.12	ms
	512		1.06	1.10		-	-	
	256		0.54	0.56		-	-	
Heater: power dissipation and temperature increase						2 - 13		mW
over humidity sensor						0.5 - 1.5		°C
Low battery indicator accuracy				±50 (Ty	/p.)			mV

(3): Maximum values must be applied to determine waiting times in I2C communication



PERFORMANCE SPECIFICATIONS (CONTINUED)

Pressure [mbar] Temperature [°C] **Relative Humidity [%RH]** Min. Max. Max. Min. Typ. Min. Max. Typ. Typ. 300 Operating Range 1200 Extended Range (4) -40 85 0 100 10 2000 300...1200 mbar 20 ... 80%RH Absolute Accuracy @25°C -2 2 -1 -3 3 1 300...1200mbar, -20...85°C -20...85°C 5...95%RH Absolute Accuracy -2 -4 2 -5 5 4 700...1000 mbar⁽⁵⁾ **Relative Accuracy** ±0.1⁽⁶⁾ @25°C OSR 8192 0.016 0.002 0.04 4096 0.021 0.003 -2048 0.028 0.004 Resolution RMS 1024 0.039 0.006 0.7 512 0.062 0.009 256 0.11 0.012 Maximum error with ±0.5 ±0.3 ±0.25 supply voltage $(V_{DD} = 1.5 V \dots 3.6 V)$ (Condition) Long-term stability ±0.5 / year ±1 / year Reflow soldering impact 2 -0.6 Recovering time after 5 days 5 days reflow (7) < 5ms 5 sec. **Response Time** (at 63% of signal recovery, From 33%RH to 75%RH. (Condition) At 3m/s air flow)

PTH CHARACTERISTICS (V_{DD} = 3.0 V, T = 25 °C UNLESS OTHERWISE NOTED)

(4): Linear range of ADC

(5): Auto-zero at one pressure point

(6): Characterized value performed on qualification devices

(7): Recovering time at least 66% of the reflow impact

DIGITAL INPUTS (SDA, SCL)

Parameter	Symbol	Conditions	Min.	Тур.	Max.	Unit
Serial data clock	SCL				400	kHz
Input high voltage	VIH		80% V _{DD}		100% V _{DD}	V
Input low voltage	VIL		0% V _{DD}		20% V _{DD}	V

DIGITAL OUTPUTS (SDA)

Parameter	Symbol	Conditions	Min.	Тур.	Max.	Unit
Output high voltage	V _{OH}	I _{source} = 1 mA	80% V _{DD}		100% V _{DD}	V
Output low voltage	Vol	I _{sink} = 1 mA	0% V _{DD}		20% V _{DD}	V
Load Capacitance	CLOAD			16		pF





PERFORMANCE CHARACTERISTICS




4.0

2.0

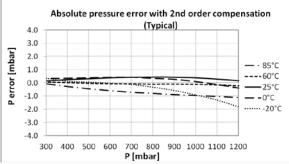


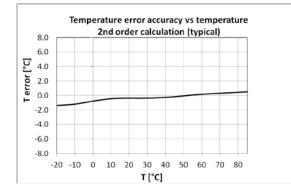


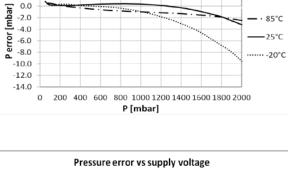


Absolute pressure error with 2nd order compensation

in extended pressure range (typical)

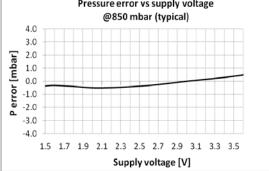

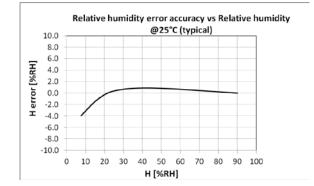

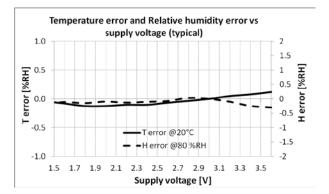



FUNCTIONAL DESCRIPTION

GENERAL

The MS8607 includes two sensors with distinctive MEMS technologies to measure pressure, humidity and temperature. The first sensor is a piezo-resistive sensor providing pressure and temperature. The second sensor is a capacitive type humidity sensor providing relative humidity. Each sensor is interfaced to a $\Delta\Sigma$ ADC integrated circuit for the digital conversion. The MS8607 converts both analog output voltages to a 24-bit digital value for the pressure and temperature measurements, and a 12-bit digital value for the relative humidity measurement.

SERIAL I²C INTERFACE

The external microcontroller clocks in the data through the input SCL (Serial CLock) and SDA (Serial DAta). Both sensors respond on the same pin SDA which is bidirectional for the l^2C bus interface. Two distinct l^2C addresses are used (one for pressure and temperature, the other for relative humidity, see Figure 2).

Module reference	Mode	Pins used
MS860702BA01	I ² C	SDA, SCL

Figure 1: Communication Protocol and pins

Sensor type	I ² C address (binary value)	I ² C address (hex. value)
Pressure and Temperature P&T	1110110	0x76
Relative Humidity RH	100000	0x40

Figure 2: I²C addresses

COMMANDS FOR PRESSURE AND TEMPERATURE

For pressure and temperature sensing, five commands are possible:

- 1. Reset
- 2. Read PROM P&T (112 bit of calibration words)
- 3. D1 conversion
- 4. D2 conversion
- 5. Read ADC (24 bit pressure / temperature)

Each command is represented over 1 byte (8 bits) as described in Figure 3. After ADC read commands, the device will return 24 bit result and after the PROM read 16 bit results. The address of the PROM is embedded inside of the read PROM P&T command using the a2, a1 and a0 bits.



	Comma	and byte							hex value
Bit number	7	6	5	4	3	2	1	0	
Bit name	PROM	CONV	-	Тур	Ad2/ Os2	Ad1/ Os1	Ad0/ Os0	Stop	
Command									
Reset	0	0	0	1	1	1	1	0	0x1E
Convert D1 (OSR=256)	0	1	0	0	0	0	0	0	0x40
Convert D1 (OSR=512)	0	1	0	0	0	0	1	0	0x42
Convert D1 (OSR=1024)	0	1	0	0	0	1	0	0	0x44
Convert D1 (OSR=2048)	0	1	0	0	0	1	1	0	0x46
Convert D1 (OSR=4096)	0	1	0	0	1	0	0	0	0x48
Convert D1 (OSR=8192)	0	1	0	0	1	0	1	0	0x4A
Convert D2 (OSR=256)	0	1	0	1	0	0	0	0	0x50
Convert D2 (OSR=512)	0	1	0	1	0	0	1	0	0x52
Convert D2 (OSR=1024)	0	1	0	1	0	1	0	0	0x54
Convert D2 (OSR=2048)	0	1	0	1	0	1	1	0	0x56
Convert D2 (OSR=4096)	0	1	0	1	1	0	0	0	0x58
Convert D2 (OSR=8192)	0	1	0	1	1	0	1	0	0x5A
ADC Read	0	0	0	0	0	0	0	0	0x00
PROM Read P&T	1	0	1	0	Ad2	Ad1	Ad0	0	0xA0 to 0xAE

Figure 3: Command structure for pressure and temperature sensing

COMMANDS FOR RELATIVE HUMIDITY

For relative humidity sensing, six commands are possible:

- 1. Reset
- 2. Write user register
- 3. Read user register
- 4. Measure RH (Hold master)
- 5. Measure RH (No Hold master)
- 6. PROM read RH

Each I2C communication message starts with the start condition and it is ended with the stop condition. The I²C address for humidity sensing is 1000000. The address of the PROM is embedded inside of the PROM read command using the a2, a1 and a0 bits. Figure 4 shows the commands with their respective code:

	8 bi	ts Co	mman	d					hex value
Bit number	7	6	5	4	3	2	1	0	
Command :									
1. Reset	1	1	1	1	1	1	1	0	0xFE
2. Write user register	1	1	1	0	0	1	1	0	0xE6
3. Read user register	1	1	1	0	0	1	1	1	0xE7
4. Measure RH (Hold master)	1	1	1	0	0	1	0	1	0xE5
5. Measure RH (No Hold master)	1	1	1	1	0	1	0	1	0xF5
6. PROM read RH	1	0	1	0	adr2	adr1	adr0	0	0xA0 to 0xAE

Figure 4: command structure for relative humidity sensing



USER REGISTER

The user register is used to configure several operating modes of the humidity sensor (resolution measurements, heater) and monitor the battery state. The possible configurations of the user register are described in the table below.


User register Bit	Bit Config	guration/Cod	ing		Default value
bit 7, bit 0	Measurer	ment resolution	on		·00'
	Bit 7	Bit 0	OSR	Resolution	
	0	0	4096	Highest	
	0	1	2048		
	1	0	1024		
	1	1	256	Lowest	
	-				
bit 6	Battery st				·0'
	'0' VDD>				
	'1' VDD<				
bit 3,4,5	Reserved	1			'000'
bit 2	on-chip h	eater:			
	'0' heater	disabled			ʻ0'
	'1' heater	enabled			
bit 1	Reserved				·0'

Figure 5: description of the user register

- Bit 7 and bit 0 configure the measurement resolution (highest resolution OSR 4096, lowest OSR 256).
- Bit 6 refers to the "Battery state", which can be monitored.
- Bits 1,3,4,5 are reserved bits, which must not be changed and default values of respective reserved bits may change over time without prior notice. Therefore, for any writing to user register, default values of reserved bits must be read first.
- Bit 2 configures the heater. It can be used for functionality diagnosis: relative humidity drops upon rising temperature. The heater consumes about 5.5mW and provides a temperature increase of approximatively 0.5-1.5°C over the humidity sensor.



PRESSURE AND TEMPERATURE CALCULATION



Variable	Description Equation	Recommended	Size [1]	Va	lue	Example /	
Vallable		variable type	[bit]	min	max	Typical	
C1	Pressure sensitivity SENS T1	unsigned int 16	16	0	65535	46372	
C2	Pressure offset OFF T1	unsigned int 16	16	0	65535	43981	
СЗ	Temperature coefficient of pressure sensitivity TCS	unsigned int 16	16	0	65535	29059	
C4	Temperature coefficient of pressure offset TCO	unsigned int 16	16	0	65535	27842	
C5	Reference temperature T REF	unsigned int 16	16	0	65535	31553	
C6	Temperature coefficient of the temperature TEMPSENS	unsigned int 16	16	0	65535	28165	

	Rea	ad digital pressure and temper	ature d	ata		
D1	Digital pressure value	unsigned int 32	24	0	16777216	6465444
D2	Digital temperature value	unsigned int 32	24	0	16777216	8077636

	(Calculate temperature	9			
dT	Difference between actual and reference temperature $dT = D2 - T_{REF} = D2 - C5 * 2^8$	signed int 32	25	-16776960	16777216	68
TEI	Actual temperature (-4085°C with 0.01°C resolution) $TEMP = 20°C + dT * TEMPSENS = 2000 + dT * C6 / 2^{23}$	signed int 32	41	-4000	8500	2000 = 20.00 °C

	Calculate tempera	ture compensate	ed pres	sure		
OFF	Offset at actual temperature ^[3] $OFF = OFF_{T1} + TCO^* dT = C2^* 2^{17} + (C4^* dT)/2^6$	signed int 64	41	-17179344900	25769410560	5764707214
SENS	Sensitivity at actual temperature ^[4] SENS = SENS _{T1} + TCS * dT = C1 * 2 ¹⁶ + (C3 * dT)/2 ⁷	signed int 64	41	-8589672450	12884705280	3039050829
Ρ	Temperature compensated pressure (101200mbar with 0.01mbar resolution) $P = D1 * SENS - OFF = (D1 * SENS / 2^{21} - OFF) / 2^{15}$	signed int 32	58	1000	120000	110002 = 1100.02 mbar

Pressure and temperature value first order

Notes [1] [2] [3] [4]

- Maximal size of intermediate result during evaluation of variable min and max have to be defined
- min and max have to be defined
 - min and max have to be defined

Figure 6: Flow chart for pressure and temperature reading and software compensation.



PRESSURE COMPENSATION (SECOND ORDER OVER TEMPERATURE)

In order to optimize the accuracy over temperature range at low temperature, it is recommended to compensate the pressure non-linearity over the temperature. This can be achieved by correcting the calculated temperature, offset and sensitivity by a second-order correction factor. The second-order factors are calculated as follows:


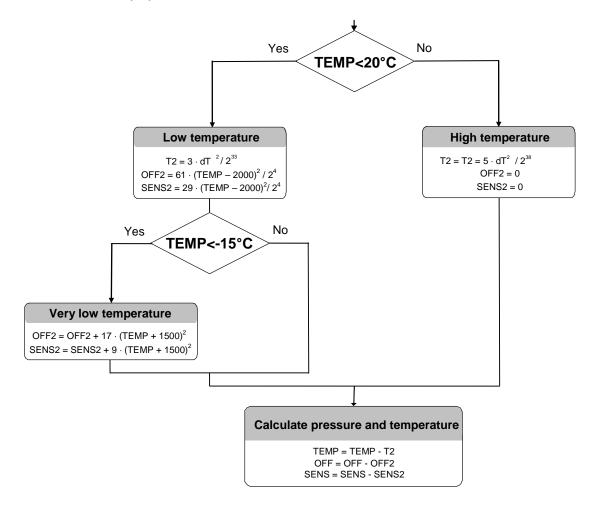


Figure 7: Flow chart for pressure and temperature to the optimum accuracy.



RELATIVE HUMIDITY CALCULATION

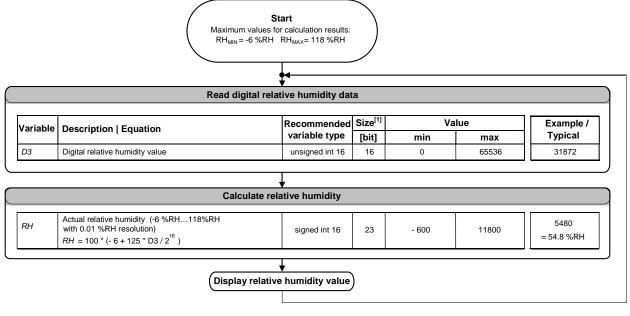

Notes [1]

Maximal size of intermediate result during evaluation of variable

Figure 8: Flow chart for pressure and temperature reading and software compensation.

To accommodate any process variation (nominal capacitance value of the humidity sensor), tolerances of the sensor above 100%RH and below 0%RH must be considered. As a consequence:

- 118%RH corresponds to 0xFF which is the maximum RH digital output that can be sent out from the ASIC. RH output can reach 118%RH and above this value, there will have a clamp of the RH output to this value.
- -6%RH corresponds to 0x00 which is the minimum RH digital output that can be sent out from the ASIC. RH output can reach -6%RH and below this value, there will have a clamp of the RH output to this value.

With the relative humidity digital value SRH, the relative humidity is obtained by the following formula (result in %RH), no matter which resolution is chosen:

$$RH = -6 + 125 \cdot \frac{D3}{2^{16}}$$

As example, the transferred 16-bit relative humidity data 0x7C80: 31872 corresponds to a relative humidity of 54.8%RH.



APPLICATION CIRCUIT

The MS8607 is a circuit that can be used in conjunction with a microcontroller by I2C protocol interface. It is designed for low-voltage systems with a supply voltage of 3 V and can be used in industrial pressure / humidity / temperature applications.

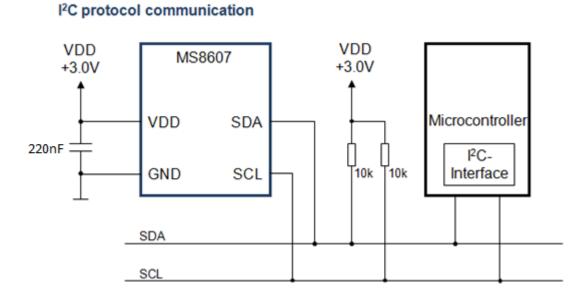


Figure 9: Typical application circuit



I²C INTERFACE: PRESSURE AND TEMPERATURE


COMMANDS


Each I^2C communication message starts with the start condition and it is ended with the stop condition. The I^2C address for pressure and temperature sensing is 1110110. The description of the commands related to pressure and temperature sensing is detailed on p. 5.

RESET SEQUENCE

The Reset sequence shall be sent once after power-on to make sure that the calibration PROM gets loaded into the internal register. It can be also used to reset the device PROM from an unknown condition.

The reset can be sent at any time. In the event that there is not a successful power on reset this may be caused by the SDA being blocked by the module in the acknowledge state. The only way to get the ASIC to function is to send several SCLs followed by a reset sequence or to repeat power on reset.






PROM READ P&T SEQUENCE

The read command for PROM shall be executed once after reset by the user to read the content of the calibration PROM and to calculate the calibration coefficients. There are in total 7 addresses resulting in a total memory of 112 bit. The addresses contain factory data and the setup, calibration coefficients, the serial code and CRC (see details on p. 15, Figure 22). The command sequence is 8 bits long with a 16 bit result which is clocked with the MSB first. The PROM Read command consists of two parts. First command sets up the system into PROM read mode (Figure 11). The second part gets the data from the system (Figure 12).

	1					1 ess	0	0	0	1	0		0 omr			1	0	0						
S		De	evic	e A	ddr	ess		W	Α			С	md	byt	e			Α	Ρ	2				
	Fro Fro	om om	Ma: Slav	ster ve			S = P =											Vrit eac					edge now	ge

Figure 11: I²C Command to read P&T memory PROM address 0xA6

		x x x x x	X X X 0	X X X X X X X X	0
Device Addres	SS	data		data	
S Device Addres	ss R A	Memory bit	15 - 8 A	Memory bit 7 - 0	ΝP
From Master From Slave	S = Start P = Stop	Condition Condition	W = Wri R = Rea		age





CONVERSION SEQUENCE

The conversion command is used to initiate uncompensated pressure (D1) or uncompensated temperature (D2) conversion. After the conversion, using ADC read command the result is clocked out with the MSB first. If the conversion is not executed before the ADC read command, or the ADC read command is repeated, it will give 0 as the output result. If the ADC read command is sent during conversion the result will be 0, the conversion will not stop and the final result will be wrong. Conversion sequence sent during the already started conversion process will yield incorrect result as well. A conversion can be started by sending the command to the ASIC. When the command is sent to the system it stays busy until conversion is done. When conversion is finished, the data can be accessed by sending a Read command. When the Acknowledge bit is sent from the ASIC, 24 SCL cycles may be sent to receive all result bits. Every 8 bits the system waits for the Acknowledge bit.




Figure 13: I²C command to initiate a pressure conversion (OSR=4096, typ=D1)

	1	1	1	0	1	1	0	0	0	0	0	0	0	0	0	0	0	0					
		De	evic	e A	ddr	ess						С	omr	mar	nd								
S		De	evic	e A	ddr	ess		W	Α			С	md	by	e			Α	Ρ				
	Fro Fro	om om	Mas Slav	ster ve			S = P =											Vrit eac		A = A N = N		5	je

Figure 14: I²C ADC read sequence

1 1 1 0 1 1 Device Address		X X X 0 X X	* * * * * * *	0 X X X X X X X X 0
S Device Address	s R A Data 23 -	- 16 A	Data 15 - 8	A Data 7 - 0 N P
From Master	S = Start Condition P = Stop Condition	W = Write R = Read	A = Acknowledge N = Not Acknowled	dge

Figure 15: I²C answer from the ASIC



I²C INTERFACE: RELATIVE HUMIDITY

COMMANDS

Each I2C communication message starts with the start condition and it is ended with the stop condition. The I2C address for humidity sensing is 1000000. The description of the commands related to humidity sensing is detailed on p. 6.

RESET SEQUENCE

This command is used for rebooting the humidity sensor by switching the power off and on again. Upon reception of this command, the humidity sensor system reinitializes and starts operation according to the default settings with the exception of the heater bit in the user register. The reset takes less than 15ms.

	1	0	0	0	0	0	0	0	0	1	1	1	1	1	1	1	0	0									
		De	vice	A	ddre	ess						С	omi	mar	nd					_							
S		De	vice	A e	ddre	ess		W	А			С	md	by	te			А	Ρ	Ι							
	Fro	om	Ma	ste	r		S	= S	tart	Co	ond	itio	n			W	= \	N rit	te		А	= A	٩ck	now	ledg	je	
	Fro	om	Sla	ve			P	= S	top	Сс	ond	itio	n			R	= R	ead	d		Ν	= 1	Vot	Acł	nov	led	lge

Figure 16: I²C Reset Command

READ AND WRITE USER REGISTER SEQUENCE

The following sequence illustrates how to read and write the user register. First, it reads the content of the user register. Then it writes the user register for configuring the humidity sensor to 8 bits measurement resolution from the default configuration.

	1	0	0	0	0	0	0	0	0	1	1	1	0	0	1	1	1	0										
		De	evic	e A	ddr	ess						С	omr	nar	nd													
S		De	evic	e A	ddr	ess		W	А			С	md	by	te			А										
										-																		
	1	0	0	0	0	0	0	1	0	Х	Х	Х	Х	Х	Х	Х	Х	0										
		De	evic	e A	ddr	ess																						
S		De	evic	e A	ddr	ess		R	А	Us	er	Reg	giste	er D	Data	a 7	- 0	Ν										
	1	0	0	0	0	0	0	0	0	1	1	1	0	0	1	1	0	0	0	0	0	0	0	0	0	1	0	
		De	evic	e A	ddr	ess						С	omr	nar	nd													
S		De	evic	e A	ddr	ess		W	А			С	md	by	te			А	Us	er l	Reg	gist	er D	Data	a 7	- 0	А	Р
	Fr	om	M	aste	er		S	= S	tar	t Co	ond	litio	n			W	= \	N rit	е		Α :	= A	ckr	now	/led	ge		
	Fr	om	ı Sl	ave			P	= S	top	Co	ond	itio	n			R	= R	ead	ł		N :	= N	ot /	Ack	nov	wle	dge	÷

- 2		rite user registe	
Elaura 17. 14		wite the extreminate	
	i. rean ann w	tite liser reniste	r commanos



MEASURE RH HOLD/NO HOLD SEQUENCE

MS8607 has two different operation modes to measure relative humidity (RH): Hold Master mode and No Hold Master mode.

No Hold Master mode allows for processing other I²C communication tasks on a bus while the humidity sensor is measuring. Figure 18 and 19 illustrate the communication sequence of both modes. In the Hold Master mode, the humidity sensor pulls down the SCK line while measuring to force the master into a wait state. By releasing the SCK line, the humidity sensor indicates that internal processing is completed and that transmission may be continued.

In the No Hold Master mode, the MCU has to poll for the termination of the internal processing of the humidity sensor. This is done by sending a start condition followed by the I²C header (0x81) as shown below. If the internal processing is finished, the humidity sensor acknowledges the poll of the MCU and data can be read by the MCU. If the measurement processing is not finished, the humidity sensor answers the Not Acknowledge bit and start condition must be issued once more.

For both modes, the measurement is stored into 14 bits. The two remaining least significant bits (LSBs) are used for transmitting status information. Bit1 of the two LSBs must be set to '1'. Bit0 is currently not assigned.

1 0 0 0 1 1 1 0 1
1 0 0 0 0 0 1 0 Device Address Hold during measurement
S Device Address R A Data 15 - 8 A Data 7 - 2 Status A
1011110From MasterS = Start ConditionW = WriteA = AcknowledgeFrom SlaveP = Stop ConditionR = ReadN = Not AcknowledgeChecksumNP
Figure 18: I ² C Measure RH Hold Master communication sequence
1 0 0 0 1 1 1 0 1
1 0 0 0 X
From Master S = Start Condition W = Write A = Acknowledge From Slave P = Stop Condition R = Read N = Not Acknowledge

Figure 19: I²C Measure RH No Hold Master communication sequence

For Hold Master sequence, the Acknowledge bit that follows the Status bit may be changed to Not Acknowledge bit followed by a stop condition to omit checksum transmission.

For No Hold Master sequence, if measurement is not completed upon "read" command, sensor does not provide ACK on bit 27 (more of these iterations are possible). If bit 45 is changed to NACK followed by stop condition, checksum transmission is omitted.



Regarding the calculation of the relative humidity value, the Status bits must be set to '0'. Refer to "Conversion of signal outputs" section p. 10. The maximum duration for measurement depends on the type of measurement and resolution chosen. Maximum values shall be chosen for the communication planning of the MCU.

I²C communication allows for repeated start conditions without closing prior sequence with stop condition.

PROM READ RH SEQUENCE

The RH PROM memory contains 7 addresses resulting in a total memory of 112 bit. The addresses contain factory defined data and CRC (see details on p. 17, Figure 23). The command sequence is 8 bits long with a 16 bit result which is clocked with the MSB first. The RH PROM Read command consists of two parts. First command sets up the system into PROM read mode (Figure 20). The second part gets the data from the system (Figure 21).

		1	1	1	0	1	1	0	0	0	1	0	1	0	0	1	1	0	0					
_			De	vic	e A	ddr	ess						СС	omr	nar	nd								
	S		De	evic	e A	ddr	ess		W	Α			C	md	byi	e			Α	Ρ				
								S = P =											Vrit ead		A = N =		5	ne

Figure 20: I²C Command to read memory address 0xA6

	1						0	1	0	Х	Х	Х			Х	Х	Х	0	Х	Х	Х			Х	Х	Х	0	
Device Address						data							data															
S		De	evic	e A	ddr	ess		R	Α		Me	emo	ory	bit	15	- 8		Α		Μ	em	ory	bit	7 -	0		Ν	Р
					tart Condition							W R =	-		-						ledo nov	,	lag	e				

Figure 21: I²C answer from ASIC (Pressure and temperature)

CYCLIC REDUNDANCY CHECK (CRC)

MS8607 contains two separate PROM memories with identical size (112-Bit): one for pressure and temperature P&T (Figure 22), the other for relative humidity RH (Figure 23). Each PROM memory can be accessed using the I^2C commands PROM Read P&T and PROM Read RH (p. 6).

Address (Hex.)	Bit 15	Bit 14	Bit 13	Bit 12	Bit 11	Bit 10	Bit 9	Bit 8	Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	
0xA0	CRC							Factory defined									
0xA2		C1															
0xA4		C2															
0xA6		C3															
0xA8		C4															
0xAA		C5															
0xAC		C6															

Figure 22: P&T Memory PROM mapping for pressure and temperature




Address	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit	Bit
(Hex.)	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
0xA0		Factory defined														
0xA2		Factory defined														
0xA4		Factory defined														
0xA6		Factory defined														
0xA8		Factory defined														
0xAA		Factory defined														
0xAC		Factory defined CRC														



A 4-bit CRC has been implemented to check the data integrity in both PROM memories. The C code below describes the CRC calculation for P&T Memory PROM and for RH Memory PROM.

C CODE EXAMPLE FOR CRC-4 CALCULATION (P&T MEMORY PROM)

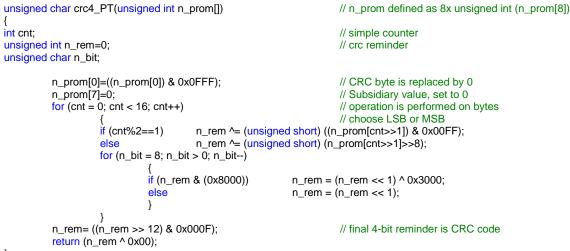

}


C CODE EXAMPLE FOR CRC-4 CALCULATION (RH MEMORY PROM)

```
unsigned char crc4_RH(unsigned int n_prom[])
                                                                       // n_prom defined as 8x unsigned int (n_prom[8])
int cnt;
                                                                       // simple counter
unsigned int n rem=0;
                                                                       // crc reminder
unsigned char n_bit;
          n_prom[6]=((n_prom[6]) & 0xFFF0);
                                                                       // CRC byte is replaced by 0
          n prom[7]=0;
                                                                       // Subsidiary value, set to 0
          for (cnt = 0; cnt < 16; cnt++)
                                                                       // operation is performed on bytes
                                                                       // choose LSB or MSB
                    {
                                        n_rem ^= (unsigned short) ((n_prom[cnt>>1]) & 0x00FF);
                    if (cnt%2==1)
                                        n_rem ^= (unsigned short) (n_prom[cnt>>1]>>8);
                    else
                    for (n_bit = 8; n_bit > 0; n_bit--)
                              if (n_rem & (0x8000))
                                                            n_rem = (n_rem << 1) ^ 0x3000;
                                                             n_{rem} = (n_{rem} << 1);
                              else
                              }
                    }
          n_rem= ((n_rem >> 12) & 0x000F);
                                                                       // final 4-bit reminder is CRC code
          return (n_rem ^ 0x00);
}
```




PIN CONFIGURATION

Pin	Nam	Туре	Function
1	VDD	Р	Positive supply voltage
3	GND	G	Ground
7	SDA	ю	I ² C data IO
8	SCL	I	Serial data clock
2,4,5,6	NC		

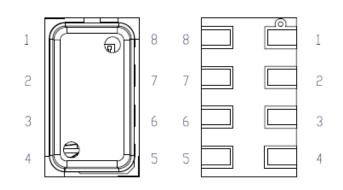


DEVICE PACKAGE OUTLINE

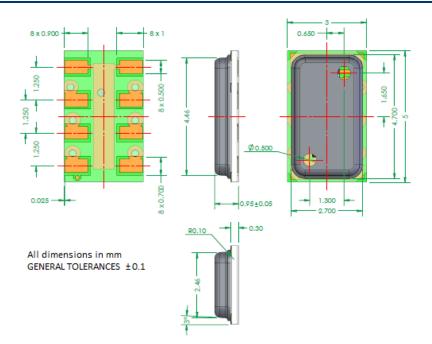




RECOMMENDED PAD LAYOUT

Pad layout for bottom side of the MS8607-02BA01 soldered onto printed circuit board.

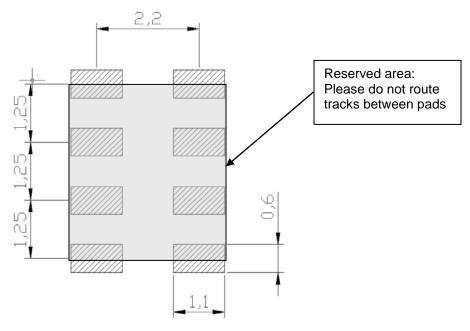

SHIPPING PACKAGE

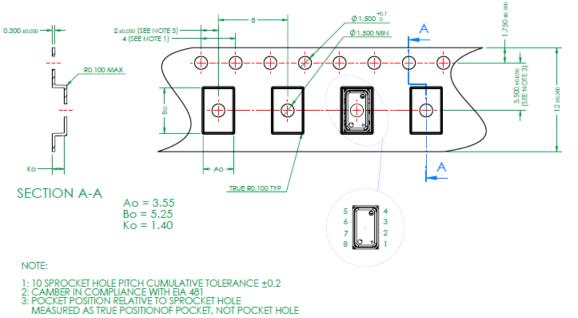



MOUNTING AND ASSEMBLY CONSIDERATIONS

SOLDERING

Please refer to the application note AN808 available on our website for all soldering issues.

MOUNTING

The MS8607 can be placed with automatic Pick & Place equipment using vacuum nozzles. It will not be damaged by the vacuum. Due to the low stress assembly the sensor does not show pressure hysteresis effects. It is important to solder all contact pads.

CONNECTION TO PCB

The package outline of the module allows the use of a flexible PCB for interconnection. This can be important for applications in watches and other special devices.

CLEANING

The MS8607 has been manufactured under cleanroom conditions. It is therefore recommended to assemble the sensor under class 10'000 or better conditions. Should this not be possible, it is recommended to protect the sensor opening during assembly from entering particles and dust. To avoid cleaning of the PCB, solder paste of type "no-clean" shall be used. Cleaning might damage the sensor!

ESD PRECAUTIONS

The electrical contact pads are protected against ESD up to 2 kV HBM (human body model). It is therefore essential to ground machines and personnel properly during assembly and handling of the device. The MS8607 is shipped in antistatic transport boxes. Any test adapters or production transport boxes used during the assembly of the sensor shall be of an equivalent antistatic material.

DECOUPLING CAPACITOR

Particular care must be taken when connecting the device to the power supply. A minimum 220nF ceramic capacitor must be placed as close as possible to the MS8607 VDD pin. This capacitor will stabilize the power supply during data conversion and thus, provide the highest possible accuracy.



ORDERING INFORMATION

Part Number / Art. Number	Product	Delivery Form
MS860702BA01-50	PTH Fusion Sensor Module 5x3mm	Tape & Reel

FACTORY CONTACTS

EUROPE

MEAS Switzerland Sàrl Ch. Chapons-des-Prés 11 CH-2022 Bevaix

Tel: +41 32 847 9550 Fax: + 41 32 847 9569 e-mail: sales.ch@meas-spec.com Website: <u>www.meas-spec.com</u> Measurement Specialties (China), Ltd. No. 26 Langshan Road Shenzhen High-Tech Park (North) Nanshan District, Shenzhen, 518057 China Tel: +86 755 3330 5088 Fax: +86 755 3330 5099 e-mail: pfg.cs.asia@meas-spec.com Website: www.meas-spec.com

ASIA

NORTH AMERICA

Measurement Specialties 45738 Northport Loop West Fremont, CA 94538

Tel: +1 800 767 1888 Fax: +1 510 498 1578 e-mail: pfg.cs.amer@meas-spec.com Website: <u>www.meas-spec.com</u>

The information in this sheet has been carefully reviewed and is believed to be accurate; however, no responsibility is assumed for inaccuracies. Furthermore, this information does not convey to the purchaser of such devices any license under the patent rights to the manufacturer. Measurement Specialties, Inc. reserves the right to make changes without further notice to any product herein. Measurement Specialties, Inc. makes no warranty, representation or guarantee regarding the suitability of its product for any particular purpose, nor does Measurement Specialties, Inc. assume any liability arising out of the application or use of any product or circuit and specifically disclaims any and all liability, including without limitation consequential or incidental damages. Typical parameters can and do vary in different applications. All operating parameters must be validated for each customer application by customer's technical experts. Measurement Specialties, Inc. does not convey any license under its patent rights nor the rights of others.

Sold in North America by: Servoflo Corporation 75 Allen Street Lexington, MA 02421 Tel: 781-862-9572

www.servoflo.com / info@servoflo.com